

EN - english



## Instructions for installation and operation

Mobile humidity meter

**DP 207**



---

Dear customers,

Thank you very much for deciding in favour of the mobile humidity measuring instrument DP 207. Please read this installation and operation manual carefully before using your DP 207 and follow our advice. A riskless operation and a correct functioning of DP 207 are only guaranteed in case of careful observation of the described instructions and notes.



BEKO TECHNOLOGIES GMBH

Im Taubental 7

D-41468 Neuss

Phone: +49 (0)2131 988 0

Fax: +49 (0)2131 988 900

Mail: [beko@beko.de](mailto:beko@beko.de)

Web: <http://www.beko.de>

---

1	Safety instructions .....	4
2	Field of application .....	6
3	Technical data .....	7
4	Dimensional drawing .....	8
5	Scope of delivery .....	9
6	Operation .....	10
7	Measurements .....	10
7.1	Measurement with measuring chamber, connection via plug nipple .....	10
7.2	Measurement without measuring chamber, connection via external thread G $\frac{1}{2}$ " .....	10
8	Maintenance .....	11
9	Calibration/ Adjustment .....	11
10	Humidity reference cells .....	12
10.1	Functional principle humidity reference cells .....	12
10.2	Performance features .....	12
10.3	Fields of application .....	12
10.4	Durability .....	12
10.5	Versions .....	12
11	Stabilization time .....	13
12	Tables lithium chloride .....	13
12.1	Humidity developing .....	13
12.2	Dew point survey .....	13
13	Conformity declaration .....	14

### 1 Safety instructions



**Please check whether this instruction corresponds with the instruments type.**

Please observe all notes indicated in this instruction manual. It contains essential information which have to be observed during installation, operation and maintenance. Therefore this instruction manual has to be read categorically by the technician as well as by the responsible user / qualified personnel before installation, initiation and maintenance.

This instruction manual has to be available at the operation site of DP 207 at any time.

Regional respectively national regulations have to be observed in addition to this instruction manual if necessary.

In case of any obscurities or questions with regards to this manual or to the instrument please contact BEKO TECHNOLOGIES.



**Warning !**

**Compressed air !**

**Contact with quickly or abruptly escaping compressed air or bursting plant components may cause severe injuries or death.**

**Measures :**

- Do not exceed the maximum operating pressure (see type label)!
- Only use pressure-resistant installation material!
- Avoid persons or objects being hit by escaping compressed air!



**Warning !**

**Supply voltage !**

**Contact with supply voltage carrying non-insulated parts may cause an electric shock with injury and death.**

**Measures :**

- Observe all applicable regulations for electrical installations (e. g. VDE 0100)!
- **Carry out maintenance work only in disconnected state!**
- All electric works are only allowed to be carried out by authorized qualified personnel.



**Warning !**

**Inadmissible operating parameters !**

**Undercutting respectively exceeding of limit values may cause danger to persons and material and may lead to functional and operational disturbances.**

**Measures :**

- Do not exceed maximum operating pressure (see type label)!
- Make sure that DP 207 is only operated within the admissible limit values indicated on the type label.
- Careful observation of the performance data of DP 207 in connection with the application.
- Do not exceed the admissible storage and transportation temperature.
- Carry out maintenance and calibrations in regular intervals.

### Further safety instructions:

- Also the applicable national regulations and safety instructions have to be observed during installation and operation.
- DP 207 is not allowed to be used in explosive areas.

### Additional remarks:

- Do not overheat the instrument!
- In case of mounting by screwing please use spanner flat (SW27)!
- DP 207 is not allowed to be disassembled!



### Attantion !

#### Malfunctions at DP 207

**Faulty installation and insufficient maintenance may lead to malfunctions at DP 207 which may affect the measuring results and which may lead to misinterpretations.**

### Measures :


Let compressed air flow off at the sampling point before measurement in order to remove condensate and particles. This avoids a soiling of DP 207 and the measuring chamber.

Stagnant air leads to long adjustment times.

### 2 Field of application

- DP 207 is a mobile, wireless humidity measuring instrument for measurements within the admissible operating parameters (see Technical data).
- DP 207 is designed for measurements behind a compressed air dryer. In case of measurements in front of a compressed air dryer the measuring instrument/ the sensor may be damaged.
- DP 207 measures the following parameters:
  - Temperature
  - Relative humidity
  - Dew point up to 50 bar
  - Upon customer request further parameters can be programmed by BEKO TECHNOLOGIES GMBH: ppm, g/kg, mg/m<sup>3</sup>, atmospheric dew point.
- DP 207 is able to measure in the following media resp. measurable gases:
  - Medical gases, inert gases, non-corrosive gases, SF<sub>6</sub>...
- For example DP 207 can be used in the following applications
  - Compressed air systems
  - Compressed air dryers
- For functioning DP 207 requires an operating voltage (see Technical data).
- DP 207 is not suitable for an application in explosive areas .
- We always recommend to use a measuring chamber
  - Advantages:
    - easy mounting and dismounting under pressure
    - fast response time
- Measuring chamber with internal thread G $\frac{1}{2}$ " and mounted plug nipple NW 7.2 for quick-lock coupling.
- Use a diffusion-tight teflon cable for non-accessible sites.

3 Technical data

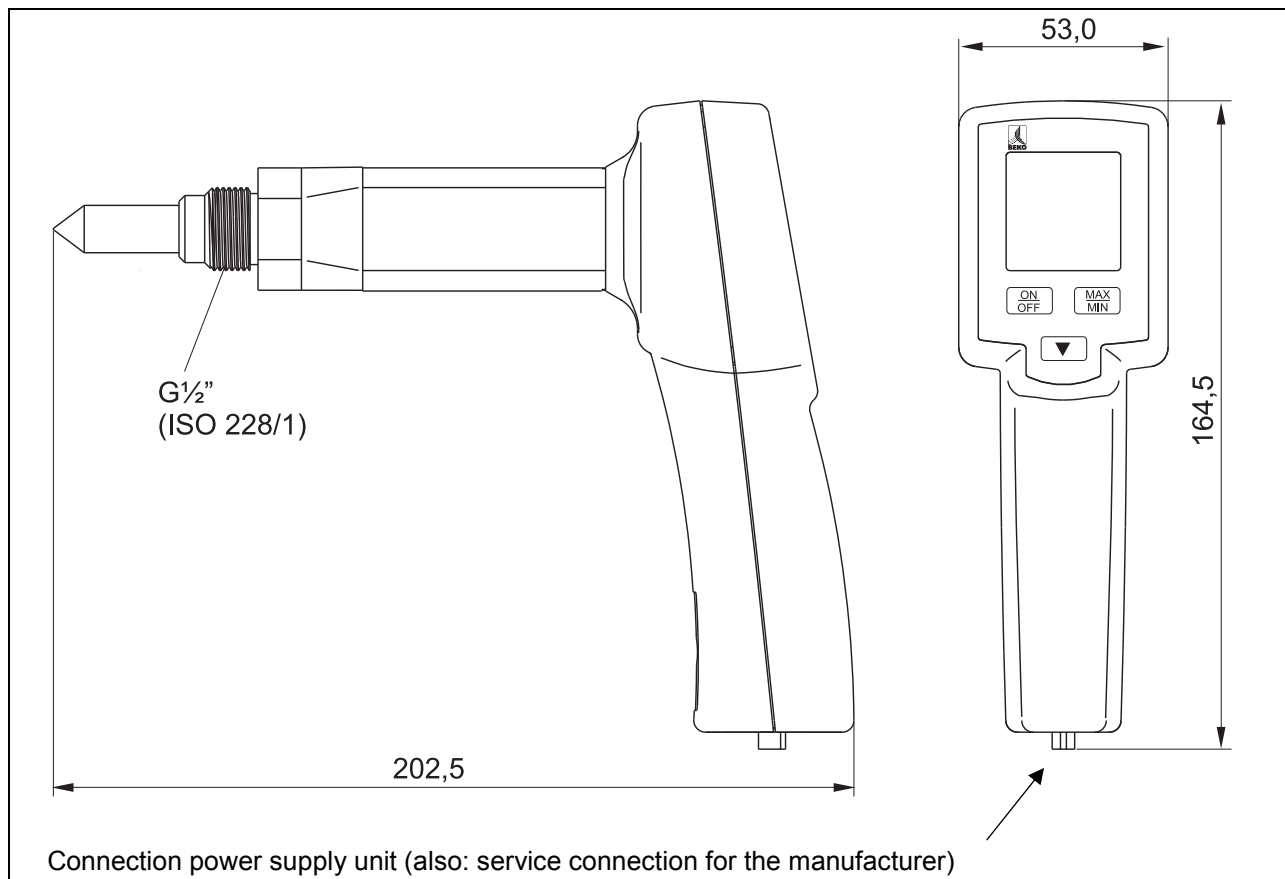
	
Measuring ranges	-80... 50°C td -20... 70°C 0... 100 % RH Upon customer request further parameters can be programmed by BEKO TECHNOLOGIES ppmV/V, atmospheric dew point, g/m <sup>3</sup> , mg/m <sup>3</sup> , g/kg, or °F
Pressure range	Mounting without measuring chamber: -1 to 50 bar (standard) Mounting with measuring chamber: -1 to 16 bar
Connection measuring chamber	Internal thread G <sup>1</sup> / <sub>2</sub> " / G <sup>1</sup> / <sub>4</sub> " Plug nipple NW 7,2; G <sup>1</sup> / <sub>4</sub> " external, for quick-lock coupling.
Purge air requirement	16 l/min when using the measuring chamber (for 7 bar)
Display	Single-line, resolution 0.1 Dew point (°C td) Relative humidity (% RH) Temperature (°C or °F), according to factory setting Maximum 3 parameters can be chosen one after the other by means of the scroll function "arrow down"
Display functions	Min., Max., battery condition
Outputs	Serial data interface (SDI) for PC Software
Input	Load of rechargeable battery only possible with power supply unit
Weight (without meas. chamber)	340 g
Protection class	IP 65



Accuracy	± 0.5°C td (-10... 50°C td) typical ± 2 °C td at -40°C td
Current supply	Internal rech. batteries (4 x 1.5 NiMh AAA) for approx. 15 h operation Indication "Low Bat." Max 2 h, remaining operation time Charging time: Max. 2 h
Continuous operation	Continuous operation with power supply unit
Power supply unit	100 – 240 VAC – 50/ 60 Hz, 0.2 A, 24 VDC – 300 mA Safety class 2, only for application in dry rooms

Operating temperature	-20... 70°C measuring gas temperature 0... 50°C ambient temperature
EMV	DIN EN 61326
Screw-in thread	G <sup>1</sup> / <sub>2</sub> " stainless steel
Housing material	Polycarbonate

## Dimensional drawing

### 4 Dimensional drawing



	<p>Measuring chamber with internal thread <math>G\frac{1}{2}''</math> / <math>G\frac{1}{4}''</math></p> <p>Mounted plug nipple NW 7.2, <math>G\frac{1}{4}''</math> external for quick-lock coupling</p>
	<p>Plug nipple NW 7.2; <math>G\frac{1}{4}''</math> external</p>





**5 Scope of delivery**

**Description**

Set DP 207  
consisting of:




**Part no.**

4008214

	<p>1. Dew point meter DP 207 up to 50 bar, including rechargeable battery</p>
	<p>2. Mobile measuring chamber up to 16 bar with quick-lock coupling</p>
	<p>3. Diffusion-tight teflon cable, length 1m, with quick coupling and plug nipple</p>
	<p>4. Power supply unit 24 VDC/110 - 240 VAC, 50 - 60 Hz for charging the battery and for long-term measurements with Euro plug</p>
	<p>5. Control and calibration set 11.3% RH</p>
	<p>6. Transport case</p>

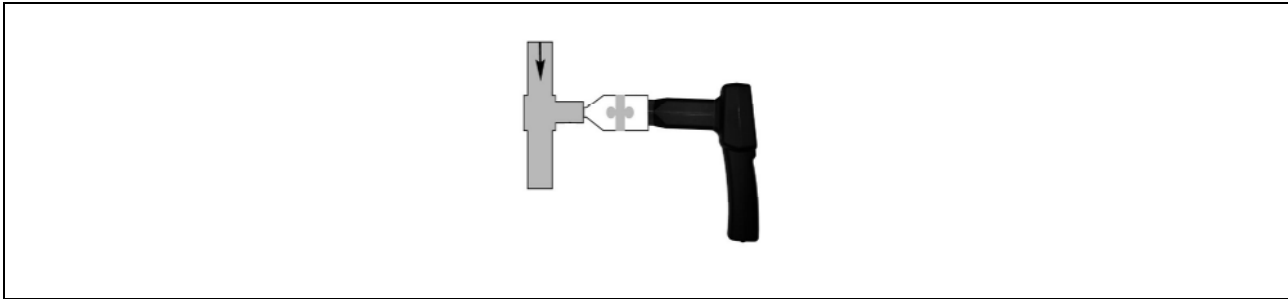
## Operation

### 6 Operation

	On/Off key for switching on respectively switching off the instrument
	Scroll key for selection of °C dew point, % relative humidity, °C temperature
	Max/Min key for indication of the maximum and minimum values since the point of time when the instrument was switched on

### 7 Measurements

#### 7.1 Measurement with measuring chamber, connection via plug nipple



##### 1. Preparation of the measuring point

Let compressed air flow off at the sampling point before measurement in order to remove condensate and particles. This avoids a soiling of DP 207 and the measuring chamber.

Stagnant air leads to long adjustment times.

If condensate occurs at the measuring point please check the compressed-air conditioning before measurement.

2. Switch on DP 207 and wait until the initialization has been finished.

Please observe the chapter "Operation".

3. Connect the measuring chamber screwed onto DP 207 with the plug nipple coupling of the measuring point

4. Wait until the value in the display of DP 207 has stabilized. Depending on the position of the measuring point this may take up to 15 minutes.

5. Disconnect the measuring chamber from the plug nipple coupling of the measuring point after measurement. Switch off DP 207 if you do not want to carry out further measurements.

#### 7.2 Measurement without measuring chamber, connection via external thread G $\frac{1}{2}$ "



##### 1. Preparation of the measuring point

Make sure that the measuring point is depressurized.

Please check the sampling point before measurement.

If condensate occurs at the measuring point you should check the compressed-air conditioning before measurement.

2. Screw the DP 207 (without mounted measuring chamber) into the measuring point (with internal thread G $\frac{1}{2}$ " ). For mounting you should use the spanner flat (SW27)!

3. Switch on DP 207 and wait until the initialization has been finished.

Please observe the chapter "Operation".

4. Charge the measuring point slowly with pressure.

5. Wait until the value in the display of DP 207 has stabilized. Depending on the position of the measuring point this may take up to 15 minutes.

6. After measurement please drain the pressure slowly from the measuring point.

7. Remove DP 207 from the measuring point. For demounting the instrument you should use the spanner flat (SW 27)!

8. If you do not want to carry out further measurements please switch off DP 207.

## 8 Maintenance

### Cleaning of the sensor

The sensor can be cleaned by careful swinging in distilled water or isopropanol.



**Remark:**

Do not touch the surface of the sensor pad.

Avoid mechanical impact to the sensor (e. g. by means of a sponge or a brush).

If the sensor is very polluted the only possibility will be an examination and maintenance by the manufacturer.

## 9 Calibration/ Adjustment

We recommend an annual calibration and if necessary adjustment of the measuring instrument at the manufacturer.

Please note the enclosed inspection certificate.

### 10 Humidity reference cells

#### 10.1 Functional principle humidity reference cells

The humidity reference cells serve as humidity measurement standards in order to provide stable humidity values for test purposes or for calibration of measuring instruments. The achievable accuracy is within the range of 1 % relative humidity.

The functional principle is based on a saturated salt solution which leads to a particular relative air humidity.

The reference cells in addition contain a semi-permeable teflon membrane (diaphragm) which separates the salt solution from the measuring area. The membrane is permeable for vaporous water molecules, but not for the salt solution or for liquid water. The humidity value in the measuring area corresponds to the relative air humidity above the salt solution. The membrane makes handling the cells much easier: The reference cells can be inserted upside down. There is no risk of the salt solution leaking out and thus spoiling the test item. Furthermore, the salt solution is protected against contamination coming from the outside. The active membrane area is rather large compared to the inside volume which leads - after insertion of the test item - to quickly stabilizing humidity values.

The cells are mechanically stable and transparent. Thus, the humidity level and the air saturation can be monitored from the outside. The sensitive membrane is protected by a plastic insert. The humidity curve in dependence on the temperature can be seen on the label of the containers. The temperature range is from 0 to 50° C.

#### 10.2 Performance features

- Reference cells for relative air humidity
- 7 versions with different salt fillings from 11% RH up to 97 % RH available
- High accuracy due to chemically pure salts
- Integrated teflon membrane as separating barrier between salt solution and measuring chamber
- Optimized housing with favourable ration of membrane surface to inner volume
- Transparent design for visual controllability of saturation and liquid level
- Temperature range from 0 to + 50° C
- Made in Germany

#### 10.3 Fields of application

Due to the high accuracy the reference cells are suitable for calibration of capacitive humidity measuring instruments.

#### 10.4 Durability

When applied correctly, the cells can be used for many years. If the liquid level changes just send in the cells to our customer service department for regeneration or for refill.

#### 10.5 Versions

The version offered is equipped with a 1/2" inner thread that allows the compressed air probe or the instrument DP 207 to be directly screwed in leak-proof. The reference cell is available with seven different salt solutions. The salts used are of the highest laboratory quality.

For further information please contact us.

## 11 Stabilization time

For testing DP 207 please screw off the cover of the reference cell and mount DP 207 carefully.



An examination of DP 207 is only allowed to be carried out after stabilization of the system, i. e. all components (salt solution, atmosphere in the calibration chamber and DP 207) have reached the same temperature and humidity values.

In practice the stabilization time for a simple examination is at least 30 minutes. For a detailed long-term examination the stabilization time will be at least 4 hours.

The stabilization has to take place in a temperature-stable ambiance, please avoid direct solar radiation. During the stabilization time the reference cell and the DP 207 are not allowed to be touched.

## 12 Tables lithium chloride

The used salt lithium chloride has nearly no interfering temperature dependency of the humidity values. The humidity tables below indicate the temperature dependency. The temperature at the salt container has to be measured and the humidity value in the tables has to be determined by interpolation.

### 12.1 Humidity developing

Filling, salt	5°C	10°C	15°C	20°C	25°C	30°C	35°C	40°C	45°C	50°C
Lithium chloride	11.26	11.29	11.30	11.31	11.30	11.28	11.25	11.21	11.16	11.10

### 12.2 Dew point survey

Lithium chloride ( LiCl )										
Temperature	5 °C	10 °C	15 °C	20 °C	25 °C	30 °C	35 °C	40 °C	45 °C	50 °C
Relative humidity	11.26 %	11.29 %	11.30 %	11.31 %	11.30 %	11.28 %	11.25 %	11.21 %	11.16 %	11.10 %
Dew point	-22.6 °C	-18.7 °C	-14.8 °C	-10.9 °C	-7.1 °C	-3.3 °C	0.5 °C	4.2 °C	7.9 °C	11.6 °C

## 13 Conformity declaration

BEKO TECHNOLOGIES GMBH  
41468 Neuss, GERMANY  
Tel: +49 2131 988-0  
www.beko.de



### EG-Konformitätserklärung

Wir erklären hiermit, dass die nachfolgend bezeichneten Produkte in der von uns gelieferten Ausführung den Anforderungen der einschlägigen Normen entsprechen:

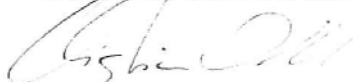
Produktbeschreibung:	Mobiles Feuchtemessgerät
Typenbezeichnung:	DP 207
Betriebsspannung:	24 VDC
Angewandte EG-Richtlinien:	2006/95/EG Niederspannungs-Richtlinie 2004/108/EG EMV-Richtlinie
Angewandte technische Normen:	EN 61326:1997 +A1:1998 +A2:2001 EN 61326:1997 +A1:1998 +A2:2001
Anbringung der CE-Kennzeichnung:	08

Die Geräte sind mit dem abgebildeten Zeichen gekennzeichnet:



Neuss, 18.12.2008

BEKO TECHNOLOGIES GMBH

  
i.V. Christian Riedel  
Leiter Qualitätsmanagement

**BEKO** TECHNOLOGIES GMBH  
41468 Neuss, GERMANY  
Tel: +49 2131 988-0  
www.beko.de



## EC Declaration of Conformity

We hereby declare that the products named below, of the type supplied by us, comply with the requirements of the relevant standards:

Product description:	Mobile moisture meter
Type designation:	DP 207
Operating voltage:	24 VDC
EC Directives applied:	2006/95/EC                      Low Voltage Directive 2004/108/EC    EMC Directive
Technical standards applied:	EN 61326:1997 +A1:1998 +A2:2001 EN 61326:1997 +A1:1998 +A2:2001
Fixing of CE marking:	08

The devices bear the depicted mark:



Neuss, 18.12.2008

**BEKO** TECHNOLOGIES GMBH

i.V. Christian Riedel  
Head of Quality Management

## Index

---

<b>A</b>		
Adjustment .....	11	
Adjustment times .....	5, 10	
<b>C</b>		
Calibration .....	11	
Cleaning of the sensor .....	11	
Conformity declaration .....	14	
Connection via external thread G $\frac{1}{2}$ " .....	10	
Connection via plug nipple .....	10	
<b>D</b>		
Dew point survey .....	13	
Dimensions .....	8	
<b>E</b>		
Explosive area .....	6	
<b>F</b>		
Fahrenheit .....	7	
Faulty installation .....	5	
Field of application .....	6	
Functional principle humidity reference cells .....	12	
<b>H</b>		
Humidity developing .....	13	
Humidity reference cells .....	12	
<b>M</b>		
Maintenance .....	11	
Measurable gases .....	6	
Measurement at non-accessible sites .....	6	
Measurement with measuring chamber .....	10	
Measurement without measuring chamber .....	10	
Measurements .....	10	
Measuring chamber .....	6	
Measuring ranges .....	7	
<b>O</b>		
Operation .....	10	
<b>P</b>		
Parameters .....	6, 7	
ppmV .....	7	
Pressure range .....	7	
<b>Q</b>		
Qualified personnel .....	4	
<b>S</b>		
Safety instructions .....	4, 5	
Sampling point compressed air .....	5, 10	
Scope of delivery .....	9	
Stabilization times .....	13	
Stagnant air .....	5, 10	
<b>T</b>		
Tables lithium chloride .....	13	
Technical data .....	7	
<b>W</b>		
Warning compressed air .....	4	
Warning supply voltage .....	4	







Technical changes and errors excepted.  
DP 207\_manual\_en\_2008-12